

Technical Bulletin


Products: Plasma	Models : TH-42PX600 TH-50PX600	Number: TB-06-08
Code: B62	Year: 2006	Date: Dec 12,06

Symptom: Vibration noise from left or right speaker.

Cause: Speaker box is making direct contact with cabinet parts.

Remedy: Installing mounting screw in the center of speaker box prevents from touching the cabinet parts and minimizes the risk of vibration noise.

Procedure: Install screw, part number THEL049 to both speaker boxes as in attached picture.

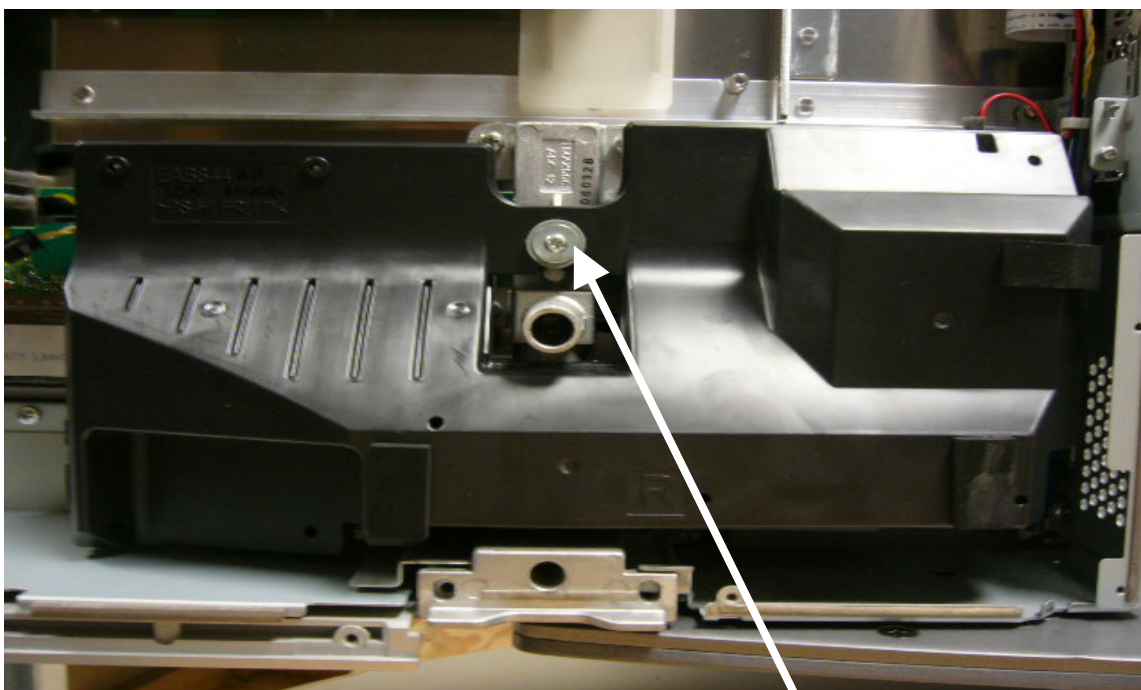

Add screw THEL049.

Please repeat the same for left speaker box.